Quick Setup Guide of One-Layer Immersion Cooling Tank

BRAND: LIAN LI

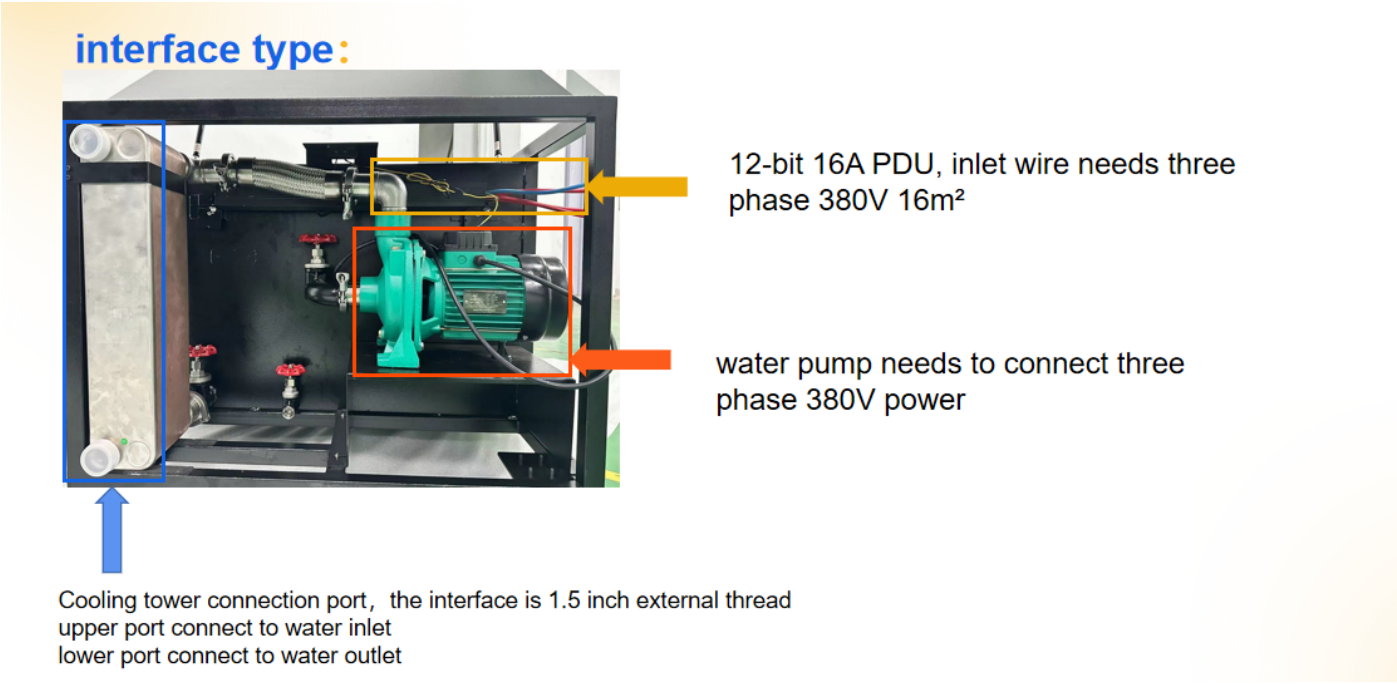

Preparations for Immersion Procedure

1. A new miner will be best, a second-hand or a repaired machine may affect the overclocking of the machine, have contaminants and possibly damage the tank and miner. If it is a used machine, it's necessary to clean the dust and dirt of the machine to thoroughly to ensure that it's clean before immersion procedure.

2. Remove the air-cooling fans of the machine and install fan-spoofers if necessary. The same operating steps apply for all miners being immersed.

Operating Instructions

1. Drop the machine into the oil tank carefully.
2. Add special insulating oil (Shell S5X or S3X recommended) until the oil exceeds the overflow marker by about 1CM
3. Connect the power cables to the tank, miner and all necessary network cables.
4. Turn on the oil pump and see that there is a visual drop between the oil overflow tank and the oil tank, indicating that the oil volume is sufficient.
5. Monitor the internal temperatures of your miner and ensure smooth operation.